



1 FLOOR PLAN
SCALE: 1:100
508.0 GSM

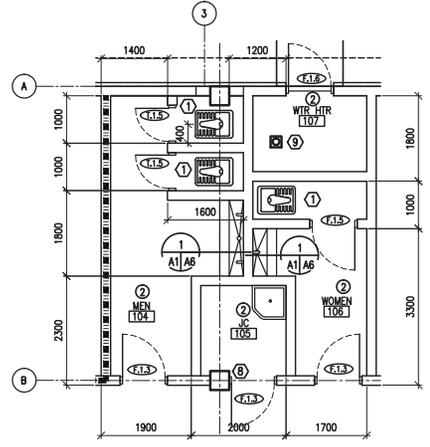

3 ENLARGED TOILET PLAN
SCALE: 1:50

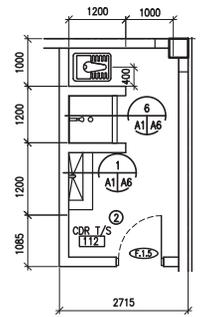

4 ENLARGED TOILET/SHOWER PLAN
SCALE: 1:50

KEY NOTES:

1. TYPICAL TOILET STALL LAYOUT - RE: DETAIL 2/A6
2. TYPICAL TOILET LAYOUT - RE: DETAIL 3/A6
3. LINE OF CANOPY ABOVE
4. NOT USED.
5. TWO-PIECE WALL THIMBLE AND TRIM PLATE FOR OPTIONAL WOOD BURNING STOVE CHIMNEY PIPE. STOVE AND PIPE BY OTHERS.
6. CONCRETE STOOP - RE: DETAIL 3/A4
7. LINE OF ROOF OVERHANG ABOVE
8. MOUNT DOOR FRAME FLUSH TO COLUMN.
9. FLOOR DRAIN - RE: P1

LEGEND:

- DOOR TYPE, SEE SHEET A5
- WINDOW TYPE, SEE SHEET A5
- KEY NOTE
- FIRE EXTINGUISHER CABINET
- 1-HOUR RATED PARTITION
- 2-HOUR RATED PARTITION
- ROOM FINISH TYPE DESIGNATION
- METAL DOWNSPOUT


GENERAL NOTES:

- A. INTERIOR PARTITIONS SHALL BE 200 MM CMU UNLESS NOTED OTHERWISE.
- B. OPENINGS FOR DOORS SHALL BE LOCATED 200 MM FROM THE ADJACENT WALL UNLESS NOTED OTHERWISE.
- C. SURFACES TO BE PAINTED SHALL BE CLEAN AND FREE OF FOREIGN MATTER BEFORE APPLICATION OF PAINT. CLEANING SHALL BE SCHEDULED SO THAT DUST AND OTHER CONTAMINANTS WILL NOT FALL ON WET, NEWLY PAINTED SURFACES.
- D. CONCRETE AND INTERIOR MASONRY SURFACES GROUTED SOLID SHALL BE ALLOWED TO DRY AT LEAST 30 DAYS BEFORE PAINTING EXCEPT CONCRETE SLAB ON GRADE WHICH SHALL BE ALLOWED TO CURE 90 DAYS BEFORE PAINTING.
- E. PAINTS CONTAINING LEAD IN EXCESS OF 0.06 PERCENT BY WEIGHT OF THE TOTAL NONVOLATILE CONTENT SHALL NOT BE USED.
- F. MERCURIAL FUNGICIDES SHALL NOT BE USED IN OIL-BASE PAINT.
- G. REMOVE LOOSE DIRT AND CLEAN SURFACES BEFORE PAINTING. APPLY PAINT TO INTERIOR STRUCTURAL RIGID FRAMINGS AND CEILINGS AND TEST FOR ADHESION. PRIMER COAT MASONRY. INITIAL FIRST COAT WITH AN ACRYLIC LATEX PAINT FOR EXTERIOR SURFACE AND A SECOND COAT WITH A WATER REPELLENT ACRYLIC LATEX PAINT.
- H. METAL DOORS AND FRAMES SHALL RECEIVE A PRIMER COAT PLUS TWO COATS OF PAINT.
- I. DIMENSIONS ARE TO STRUCTURAL COLUMN GRID, EDGE OF WINDOW OPENINGS, AND HINGE SIDE OF DOOR OPENINGS.
- J. FILL ANULAR SPACE AT ANY AND ALL PENETRATIONS IN FIRE RATED FLOORS, PARTITIONS AND CEILINGS WITH APPROPRIATE FIRE STOPPING MATERIALS.
- K. CORRIDOR WALLS ARE NOT RATED IN ACCORDANCE WITH NFPA 101, 38.3.6.1(2).
- L. PROVIDE OCCUPANCY SEPARATION IN ACCORDANCE WITH NFPA 101, 38.1.2, 38.3.2, AND TABLE 6.1.14.4.1.

ROOM FINISHES:

1. WALLS: PAINTED PLASTER
FLOOR: SEALED CONCRETE
CEILING: PAINTED PLASTER APPLIED TO STRUCTURE
2. WALLS: 2400 MM HIGH CERAMIC TILE
WAINSCOT, PAINTED PLASTER ABOVE WAINSCOT
FLOOR: CERAMIC TILE
CEILING: PAINTED PLASTER

AD16

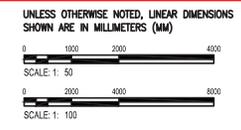

US Army Corps of Engineers
Afghanistan Engineer District

NO.	REVISION	DATE	BY

DESIGNED BY: DATE: 09-30-09	SUBMITTED BY: BAKER
DRAWN BY: K.J.G.	CHECKED BY: N.L.J.
FILE NO.: ANP/DA-101/XX	

Michael Baker Corp.
A unit of Michael Baker Corporation
Attn: Business Park
1600 Township Pike, 15108
Morrow, Pennsylvania
www.mbakercorp.com

STANDARD DESIGN
ADMINISTRATION BUILDING (508 GSM)
WOOD FIELD FIGHT OPERATIONS
FLOOR PLAN

SHEET REFERENCE NUMBER:
A1

100% SUBMISSION